



SETHI HOUSE, PESHAWAR

CONSTRUCTION RECORD

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

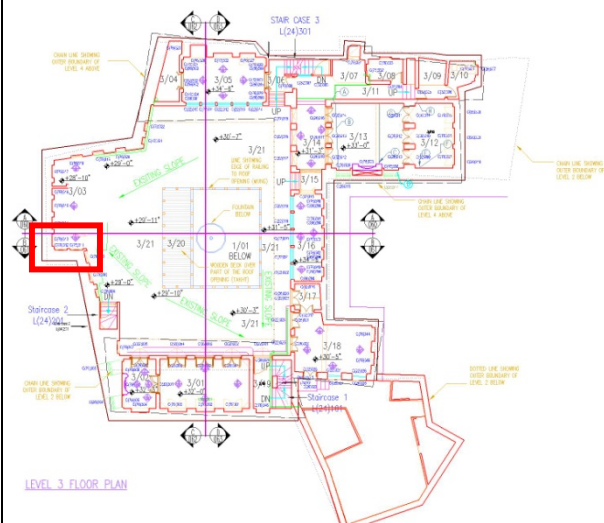
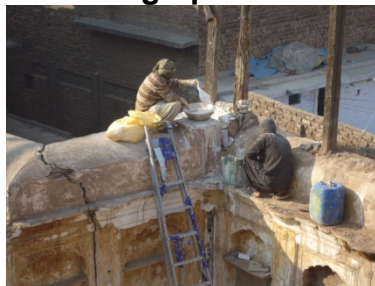
Name of Structure:
Wall

Area Mohallah Sethian	Building No. Sethi House I	Room No. 3/03
-----------------------------	----------------------------------	-------------------------

Title of Works:
Cracks Filling

Ref. Drg:
L (22)001
2.1 Report (Scope of Work & Survey of Treatment)

Vertical cracks were found in the South West corner of Demolished room 3/03 and were necessary to repair the h'rrary Project Director allowed to do the same.

2.2 Drawings

2.3 Photographs

2.4 Specification of Materials
Gypsum + Lime Water

2.5 Form prepared by

Date: 18 Jan, 2011

Name
Muhammad Ijaz

Designation Architect/ Team Leader

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

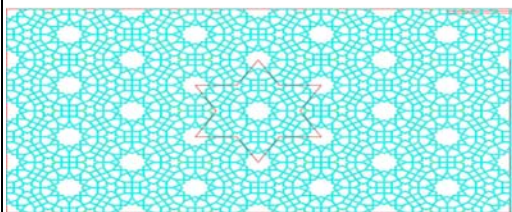
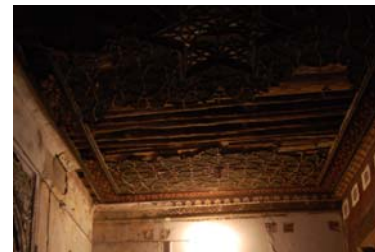
Name of Structure:
Roof, Wooden Railing

Area Mohallah Sethian	Building No. Sethi House I	Room No. 4/05, 3/21
-----------------------------	-------------------------------	------------------------

Title of Works:
4/05; Fixing of Wooden Railing, 3/21; Construction of Roof

Ref. Drg:
L (22)005 L (22)006
2.1 Report (Scope of Work & Survey of Treatment)

4/05 Original Railing not aligned, or Strong enough for support.
3/21: Removing of mud from roof.

2.2 Drawings

Plan
2.3 Photographs

2.4 Specification of Materials
Deodar Wood

2.5 Form prepared by

Date: 24th Jan, 2011

Name Hafiz Arif

Designation

Signature

Name

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar

2. CONSTRUCTION RECORD

Name of Structure:
Roof

Area Mohallah Sethian	Building No. Sethi House I	Room No. 3/03 4/02,
-----------------------------	-------------------------------	---------------------------

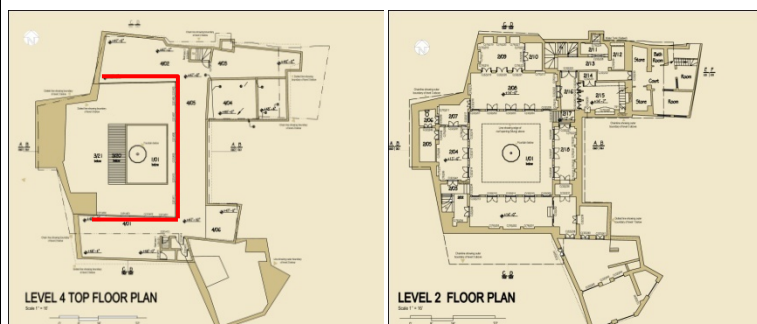
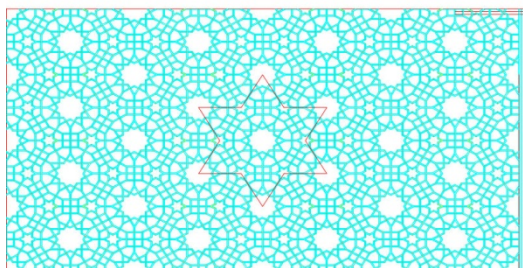
Title of Works:
Roof, Wood Preparation: Tarseem Bandi 2/08 & 2/04, Railing for 4/01; 4/02 & 4/05

Ref. Drg:
L (22)004, L (22)005

2.1 Report (Scope of Work & Survey of Treatment)

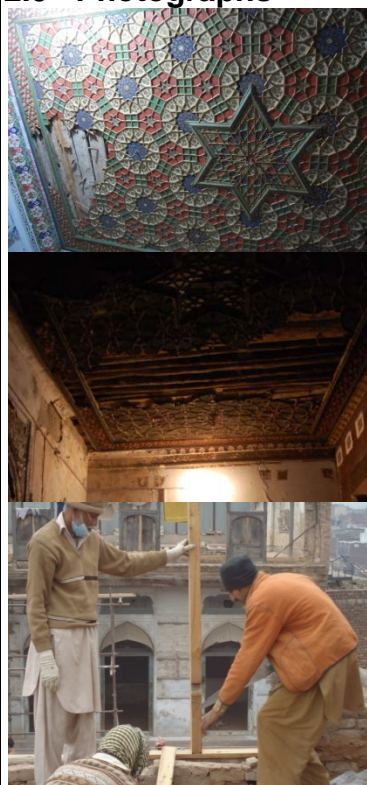
After removing layers of existing roof 3/03 necessary to construct the roof according to set pattern
Original Railing of roof 4/01, 4/02 and 4/05 not aligned, or Strong enough for support.
Tarseem Bandi 2/09 missing in portions.

2.2 Drawings



Plan

2.3 Photographs



2.4 Specification of Materials
Deodar Wood

2.5 Form prepared by

Date: 20th Jan, 2011

Name Hafiz Arif

Designation

Signature

Name

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof

Area Mohallah Sethian	Building No. Sehti House I	Room No. 3/03 2/04;2/09 4/02
-----------------------------	-------------------------------	---------------------------------------

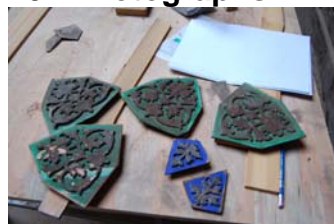
Title of Works:
Laying of New Roof Layer on 3/03
Wood Preparation: Tarseem Bandi 2/08 & 2/04,
Railing for 4/01; 4/02 & 4/05

Ref. Drg:
L (22)001

2.1 Report (Scope of Work & Survey of Treatment)

3/03 Laying New Wooden Planks as original were missing or severely damaged.
Termite Proofing 3 Coats on both rafters and planks.
Layer Cold Bitumen and Polythene for Water Proofing. Pouring Course of Lime-Aggregate Mix Maintaining 1" slope thus defining new drainage point as shown on drawing below (blue).
2/04; 2/09 Pieces for Tarseem Bandi being prepared. Prefabrication to be completed by early next week.
4/01;4/05 Beams being prepared for railings.
4/02 Erected beams and posts along first edge - as shown in photograph.

2.2 Drawings

Plan
2.3 Photographs

2.4 Specification of Materials

Termite Repellent
Bitumen 1mm
2 Polythene Sheets 5mm each
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate)
Deodar Wood

2.5 Form prepared by

Date: 21 Jan, 2011

Name
Mariyam Nizam

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof

Area Mohallah Sethian	Building No. Sehti House I	Room No. 3/21 2/04;2/09 4/02
-----------------------------	-------------------------------	---------------------------------------

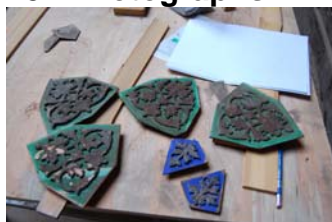
Title of Works:
Dismantling of existing Roof layers
Wood Preparation: Tarseem Bandi 2/08 & 2/04,
Prefabrication of beams Parda Wall for 4/02 & 4/05
Leveling Roof floor removing excess debris

Ref. Drg:
L (22)001

2.1 Report (Scope of Work & Survey of Treatment)

3/21 Removed Mud Layer 26"
Removed Brick layer
Exposed Wooden Beams
2/08; 2/04 Tarseem bandi pieces prefabrication will be completed by next week
4/02; 4/05 Parda wall will be installed on Monday

2.2 Drawings

Plan
2.3 Photographs

2.4 Specification of Materials

Removed Mud Layer 26"
Removed Brick Layer 7"x1.5"x 3"

2.5 Form prepared by

Date: 22 Jan, 2011

Name
Mariyam Nizam

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

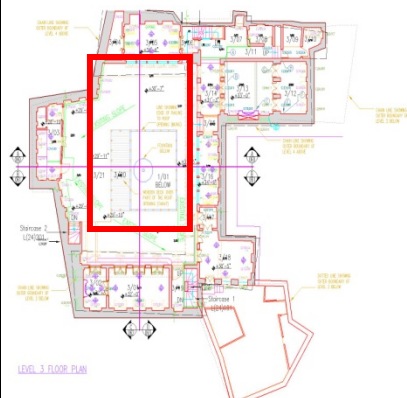
Name of Structure:
Roof

Area Mohallah Sethian	Building No. Sehti House I	Room No. 3/21
-----------------------------	-------------------------------	------------------

Title of Works:
Laying of New Roof Layer on 3/21
Wood Preparation and fixing.

Ref. Drg:
L (22)005
2.1 Report (Scope of Work & Survey of Treatment)

3/03 Laying New Wooden Planks as original were missing or severely damaged.
Termite Proofing 3 Coats on both rafters and planks.
Layer Cold Bitumen and Polythene for Water Proofing. Pouring Course of Lime-Aggregate Mix Maintaining 1:10 slope thus defining new drainage point as shown on drawing below (blue).

2.2 Drawings

2.3 Photographs

2.4 Specification of Materials

Termite Repellent Biflax of FMC
Bitumen 1mm
2 Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate)
Deodar Wood

2.5 Form prepared by

Date: 23rd Jan, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof

Area Mohallah Sethian	Building No. Sehti House I	Room No. 3/21 4/02; 4/05
-----------------------------	-------------------------------	--------------------------------

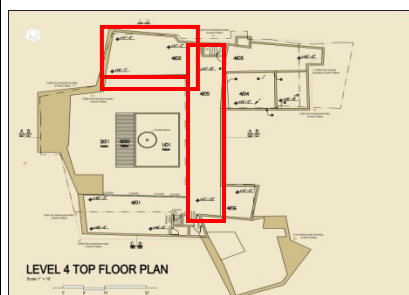
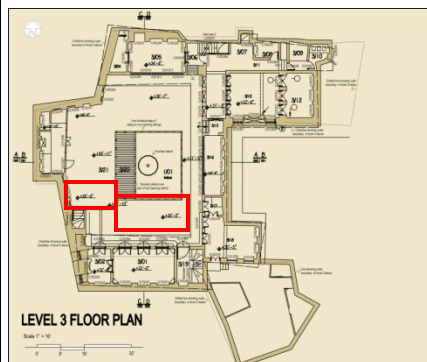
Title of Works:

3/21: Removing of mud layers; removal of dilapidated rafters in front of stair case, Brick masonry and filling Cracks.
4/02: Mounting of Wooden Beam of the railing. Laying of Brick Tiles.
4/05: Wood Preparation and Strengthen of Columns. Cleaning, laying bitumen layer

Ref. Drg:

L (22)005
L (22)006
2.1 Report (Scope of Work & Survey of Treatment)

3/21: Removing mud layers to reduce Load. Brick masonry to complete the missing Lower portion of a corner of the wall in lime mortar. Removed the dilapidated rafters in front of Western stair case for replacement. Fill the cracks in the newly built layer of kankar coarse lime.
4/02;4/05 Beams being prepared and fixed for railings. Cleaned the area and apply bitumen layer 1mm cold.

2.2 Drawings


Plan

2.3 Photographs

2.4 Specification of Materials

Bitumen 1mm
2 Polythene Sheets 5mm each
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate)
Deodar Wood

2.5 Form prepared by

Date: 25th Jan, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar

2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area	Building No.	Room No.
Mohallah Sethian	Sehti House I	2/04, 2/09, 3/21 4/02; 4/05

Title of Works:

2/04: Preparation of wood pieces of Terseem Bandi
2/09: Fixing wooden pieces to the missing portion of Terseem Bandi.
3/21B& C: Removing of mud layers in part B and cleaning of rafters; Removing of mud layers in part C.
4/05: Applied Lime Mortar on the Brick Tiles.

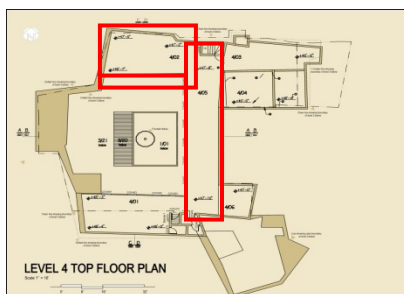
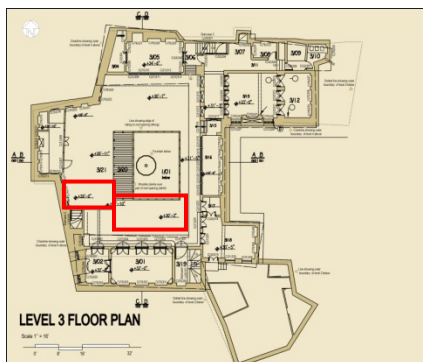
Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

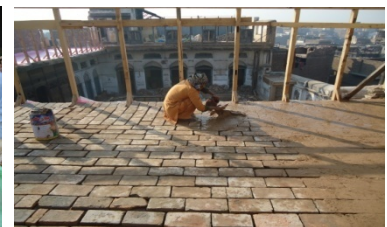
3/21: Removing mud layers to reduce Load. Brick masonry to construct the roof Western stair case and placed batons , capped with Deodar planks, applied termite repellent 3coats, 1mm bitumen layer and kankar coarse Lime.
4/02: Lime mortar layer to fill the gaps in between brick tiles for water tightening,
4/05: : Spread Jumbo Ion and Started laying Brick Tiles Layer.

2.2 Drawings



Plan

2.3 Photographs



2.4 Specification of Materials

Bitumen 1mm
2 Polythene Sheets 5mm each
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate)
Deodar Wood

2.5 Form prepared by

Date: 26th Jan, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi,

Area Mohallah Sethian	Building No. Sehti House I	Room No. 2/04;2/09 4/02
-----------------------------	-------------------------------	-------------------------------

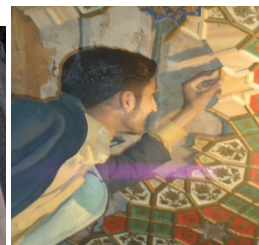
Title of Works:
2/04: Wood Preparation for Tarseem Bandi
2/09: Tarseem Bandi in Progress
Railing for 4/02 & Brick Tiles for 4/05

Ref. Drg:
L (22)001

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Wood pieces for Terseem bandi in progress.
2/09: Fixing of wood Pieces for Tarseem Band in progress according to schedule.
4/01; 4/02: Beams being prepared for railings.
4/05: Brick tiles completed.

2.2 Drawings

Plan
2.3 Photographs

2.4 Specification of Materials

Brick tiles 2"x6"x12" reused
Deodar Wood

2.5 Form prepared by

Date: 27th Jan, 2011

Name
Hafiz Aif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 2/04, 2/09, 3/21 4/02; 4/05
-----------------------------	-------------------------------	---

Title of Works:

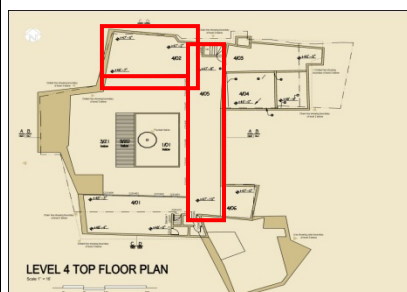
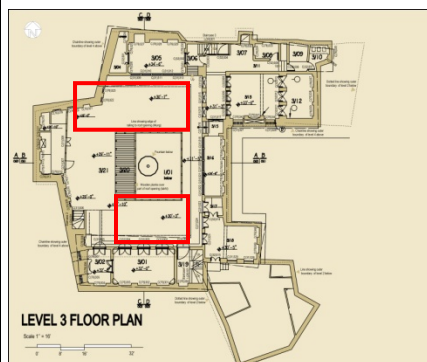
2/04: Preparation of wood pieces of Terseem Bandi
2/09: Fixing wooden pieces to the missing portion of Terseem Bandi.
3/21B& C: Removing of mud layers in part B and cleaning of rafters; Removing of mud layers in part C.
4/05: Applied Lime Mortar on the Brick Tiles.

Ref. Drg:

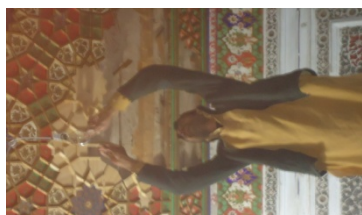
L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

3/21: Removing mud layers to reduce Load. Brick masonry to construct the roof Western stair case and placed batons , capped with Deodar planks, applied termite repellent 3coats, 1mm bitumen layer and kankar coarse Lime.
4/05: Lime mortar layer to fill the gaps in between brick tiles for water tightening,

2.2 Drawings


Plan

2.3 Photographs

2.4 Specification of Materials

Bitumen 1mm
2 Polythene Sheets 5mm each
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate)
Deodar Wood

2.5 Form prepared by

Date: 28th Jan, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 2/04, 2/09, 3/21 4/02, 4/05
-----------------------------	-------------------------------	---

Title of Works:

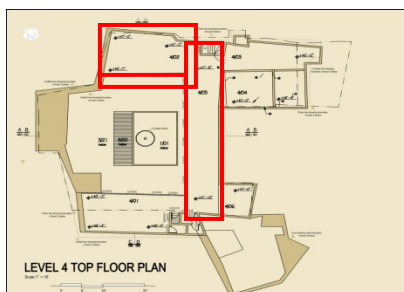
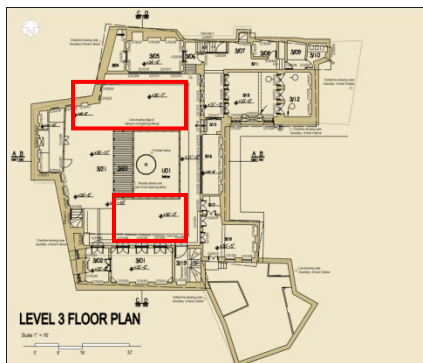
2/09: Fixing wooden pieces to the missing portion of Terseem Bandi.
3/21B: Arrangement for pouring of roof.
3/21C: Removing of mud layers in part C.
4/01&4/05: Finishing treatment with dismounted railing parts and preparing new supporting parts of railing.

Ref. Drg:

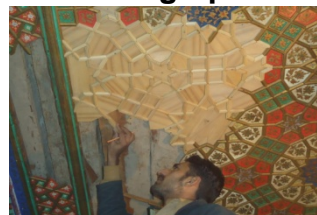
L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/09: Fixing of new wooden pieces with Terseem Bandi to complete the missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/21B: Cleaning, Capping the spaces in-between the rafters with bricks 2"x4"x8" and 0.75" new deodar wooden planks And pouring of kankar lime mix aggregate. 1:2:4.
3/21C: Removing of layers from the roof, 2" brick, lime mortar 2", mud layers. 10".
4/01&4/05: Dismounted railing is under the finishing process. Removing the a thin layer to make the surface plane, Re-sizing, patch work, Finishing.

2.2 Drawings


Plan

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate)

2.5 Form prepared by

Date: 29th Jan, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 2/09, 3/21B,C,D 4/02; 4/05
-----------------------------	-------------------------------	--

Title of Works:

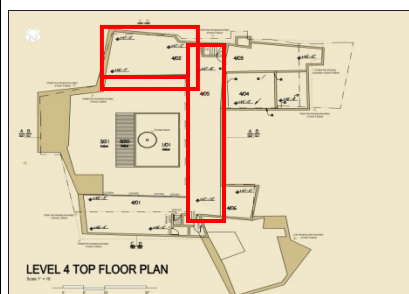
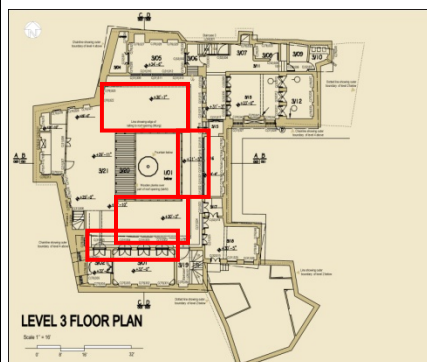
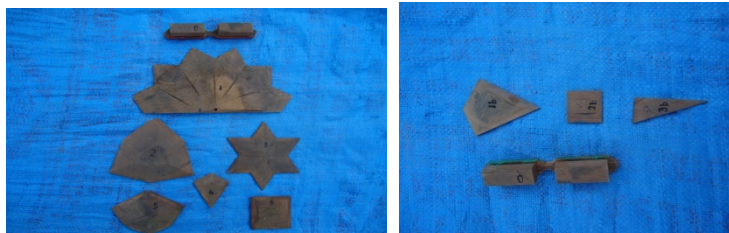
2/09: Preparation of wood pieces for the missing portion of Terseem Bandi.
3/21B: Completed the remaining portion of roof.
3/21C: Removing of mud layers in part C & D.
4/01&4/05: Finishing treatment with dismounted railing parts and preparing new supporting parts of railing and preparation of the sample of louver.

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/09: Preparation of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/21B: 2/3 of the roof was completed last night and the remaining portion of the roof was completed.
3/21C&D: Removing of layers from the roof, 2" brick, lime mortar 2", mud layers. 10".
4/01&4/05: Dismounted railing is under the finishing process. Removing the a thin layer to make the surface plane, Re-sizing, patch work, Finishing and preparing the sample of louver to fill the spaces in-between the windows.

2.2 Drawings

Plan
2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate)

2.5 Form prepared by

Date: 30th Jan, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 2/09, 3/21B,C,D 4/02; 4/05
-----------------------------	-------------------------------	--

Title of Works:

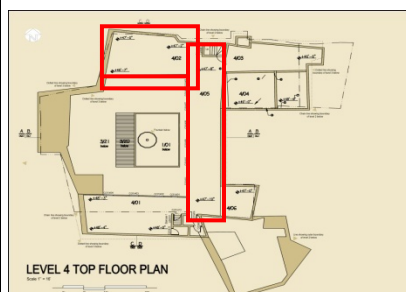
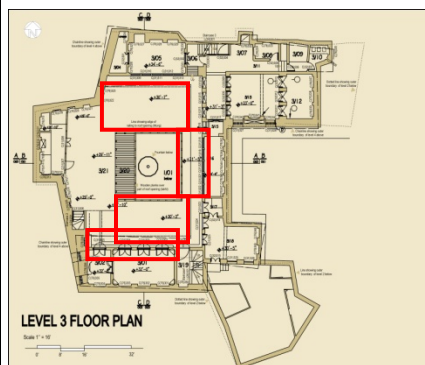
2/09: Fixing of wood pieces in the missing portion of Terseem Bandi.
3/21B: Filling the cracks in the newly constructed roof.
3/21C: Removing of mud layers in part C & D.
4/01&4/05: Finishing treatment with dismounted railing parts and preparing new supporting parts of railing and preparation of the sample of louver.

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/09: Preparation of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/21B: 2/3 of the roof was completed last night and the remaining portion of the roof was completed.
3/21C&D: Removing of layers from the roof, 2" brick, lime mortar 2", mud layers. 10".
4/01&4/05: Dismounted railing is under the finishing process. Removing the a thin layer to make the surface plane, Re-sizing, patch work, Finishing and preparing the sample of louver to fill the spaces in-between the windows.

2.2 Drawings


Plan

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 31st Jan, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 2/09, 3/21,C,D 4/02; 4/05
-----------------------------	-------------------------------	---

Title of Works:

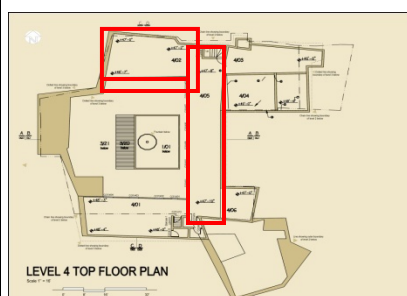
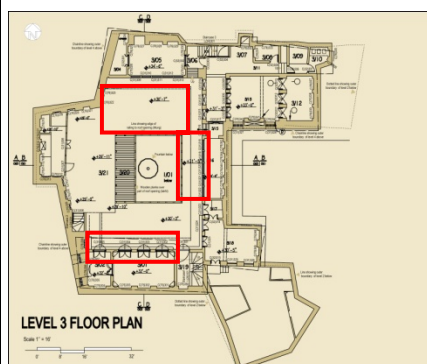
2/09: Fixing of wood pieces in the missing portion of Terseem Bandi.
3/21C: Cleaning, and applying layers of roof, Removing of mud layers in part D.
4/02&4/05: Erecting of top beam in the railing and Finishing treatment to newly constructed ghalta.

Ref. Drg:

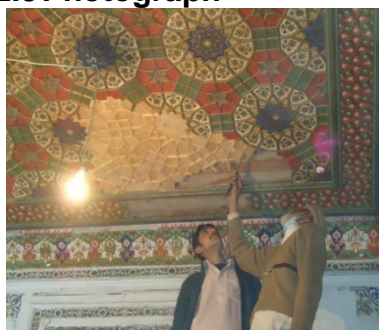
L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/09: Fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/21C&D: Removing of layers from the roof, 2" brick, lime mortar 2", mud layers. 10" in part D and after cleaning applied Anti-termite, bricks, polyethylene sheet and lime mortar layers in the part C.
4/01&4/05: Top wood beam erected and finishing treatment to the newly constructed ghalta. Removing the a thin layer Of the dismantled railing to make the surface plane, Re-sizing, patch work, Finishing and preparing the sample of louver to fill the spaces in-between the windows.

2.2 Drawings


Plan

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 2nd Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 204, 2/09, 3/21,C,D 4/01;
-----------------------------	-------------------------------	---

Title of Works:

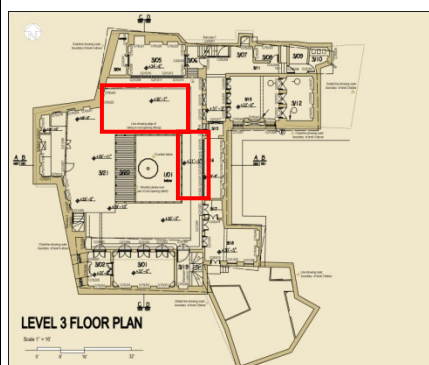
2/04: Preparation of Wood Pieces for Terseem Bandi In the Missing Portions.
2/09: Fixing of wood pieces in the missing portion of Terseem Bandi.
3/21D: Cleaning, and applying layers of roof, Removing of mud layers in part D.
4/01: Clearing the Space to Erect railing.

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Preparation of Wood Pieces for Terseem Bandi in the Missing portions.
2/09: Fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/21D: Cleaning the spaces and fixing new wood logs to re-strengthen the weaker corner of 3//21C& D and capping the Spaces with bricks and planks, applied anti-termite, spread polyethylene sheet, and lime mortar.
Anti-termite, bricks, polyethylene sheet and lime mortar layers in the part C.
4/01: Clearing the space to erect the wood railing.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 3rd Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar

2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 204, 2/09, 3/01, 3/18 4/01, 4,05
-----------------------------	-------------------------------	--

Title of Works:

2/04: Preparation of Wood Pieces for Terseem Bandi In the Missing Portions.
2/09: Fixing of wood pieces in the missing portion of Terseem Bandi.
3/18: Fixing New Wood Pieces in the False Ceiling.
4/01,05: Preparing the Dismounted Railing.

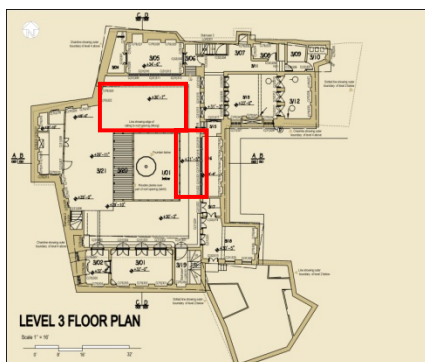
Ref. Drg:

L (22)004
L (22)005

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Preparation of Wood Pieces for Terseem Bandi in the Missing portions.
2/09: Fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/18: Fixing new wood pieces to repair the false ceiling.

2.2 Drawings



2.3 Photograph



2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 4th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area	Building No.	Room No.
Mohallah Sethian	Sehti House I	204, 2/09, 3/01, 3/18, 4/01, 2/07

Title of Works:

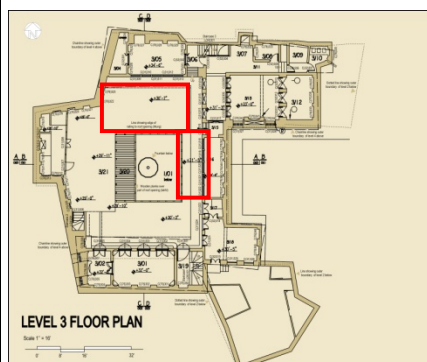
2/04: Preparation of Wood Pieces for Terseem Bandi In the Missing Portions.
2/09: Fixing of wood pieces in the missing portion of Terseem Bandi.
3/18: Fixing New Wood Pieces in the False Ceiling.
4/01, 05: Preparing the Dismounted Railing.
2/07: Fixing New Wood Pieces in the False Ceiling.
Steel Wire Loop tie

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Preparation of Wood Pieces for Terseem Bandi in the Missing portions.
2/09: Fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/18: Fixing new wood pieces to repair the false ceiling.
2/07: Fixing New Wood Pieces in the Terseem Bandi.
Steel Wire loop is fixed according to the instruction of Mr. Amin Tariq.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 9th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 204, 2/05, 3/16, 3/21 4/01, SQ
-----------------------------	-------------------------------	--

Title of Works:

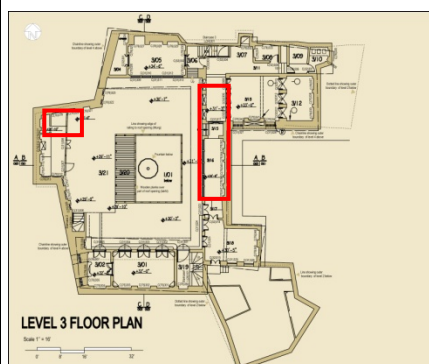
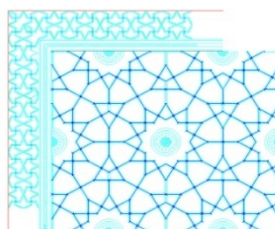
2/04: Preparation of Wood Pieces for Terseem Bandi In the Missing Portions.
2/05: Preparation and Fixing of wood pieces in the missing portion of Terseem Bandi.
3/16: Removing the Brick Layer of Flooring.
3/21: Another Sample of the flooring.
4/01, 05: Preparing the Dismounted Railing and fixing columns and angular supports.
S.Q: Steel Wire Loop tie

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Preparation of Wood Pieces for Terseem Bandi in the Missing portions.
2/05: Preparation and fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/16: Removing the Brick Layer of Flooring and shifting the melba outside the House.
S.Q: Steel Wire loop tied according to the instruction of Mr. Amin Tariq.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 10th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 204, 2/05, 3/16,15,14, 3/21,4/01, SQ
-----------------------------	-------------------------------	---

Title of Works:

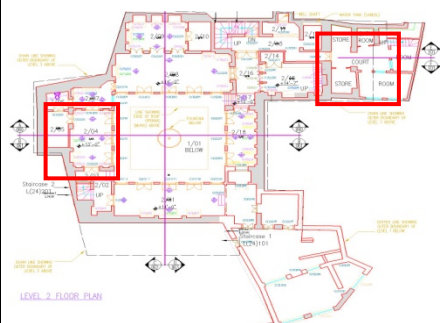
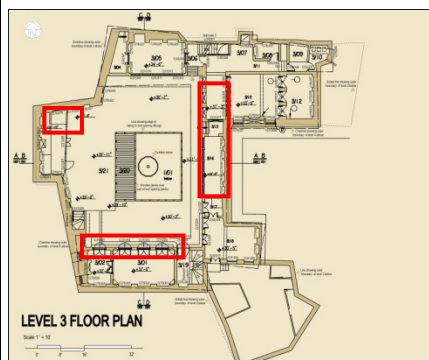
2/04: Preparation of Wooden Gola for Terseem Bandi In the Missing Portions.
2/05: Preparation and Fixing of wood pieces in the missing portion of Terseem Bandi.
3/16, 15, 14: Removing the Layers of Flooring.
3/21: 2nd Sample of the flooring.
4/01: Preparing the Upper Beam of the Railing. Purchased New Wood.
S.Q: Steel Wire Loop tied.

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Preparation of Wood Pieces for Terseem Bandi in the Missing portions.
2/05: Preparation and fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/16, 15, 14: Removing the Brick Layer of Flooring and shifting the melba outside the House.
S.Q: Steel Wire loop tied according to the instruction of Mr. Amin Tariq, but he doesn't look satisfied so looking more.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 11th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area	Building No.	Room No.
Mohallah Sethian	Sehti House I	204, 2/05, 3/16, 15, 14, 4/01, SQ

Title of Works:

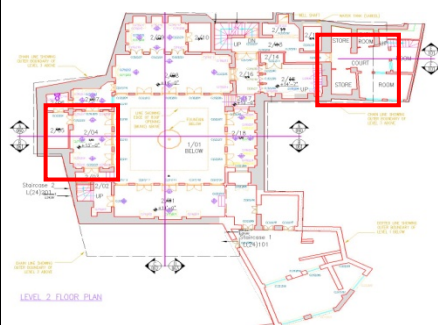
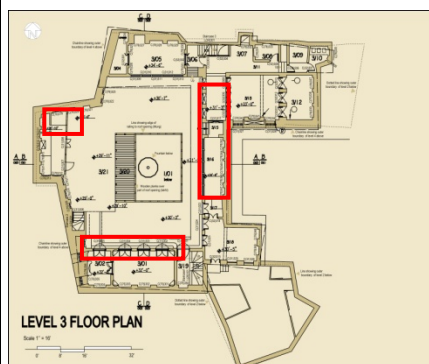
2/04: Preparing Wooden Gola for Terseem Bandi In the Missing Portions.
2/05: Preparing and Fixing of wood pieces in the missing portion of Terseem Bandi.
3/16, 15, 14: Construction of Layers of Flooring.
3/21: 2nd Sample of the Flooring and Protect the Area from Heavy Rain.
4/01: Preparing the Upper Beam of the Railing. Purchased New Wood.
S.Q: Steel Wire Loop.

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Preparing Wooden Gola for Terseem Bandi of Missing Portions.
2/05: Preparation and fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/16, 15, 14: Cleaned and Replaced 4 rafters with new in 3/16, applied anti termite, spread polyethylene sheet and poured lime mortar according to the level.
S.Q: Steel Wire loop tied according to the instruction of Mr. Amin Tari, but he doesn't look satisfied so looking more.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 12th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 204, 2/05, 3/21, SQ
-----------------------------	-------------------------------	------------------------------------

Title of Works:

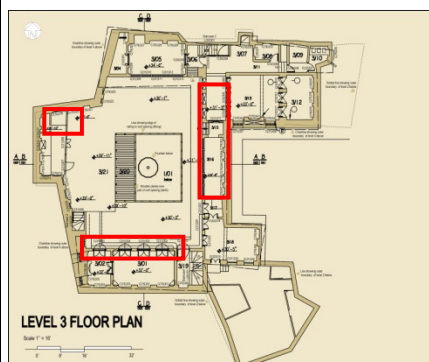
2/04: Preparing Wooden Gola for Terseem Bandi In the Missing Portions.
2/05: Preparing and Fixing of wood pieces in the missing portion of Terseem Bandi.
3/21: Protect the Area from Heavy Rain.
S.Q: Steel Wire Loop.

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Preparing Wooden Gola for Terseem Bandi of Missing Portions.
2/05: Preparation and fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
S.Q: Steel Wire loop tied according to the instruction of Mr. Amin Tariq, but he doesn't look satisfied so looking more.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 13th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 204, 2/05, 3/21, SQ
-----------------------------	-------------------------------	------------------------------------

Title of Works:

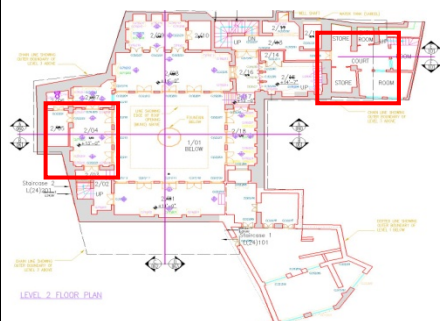
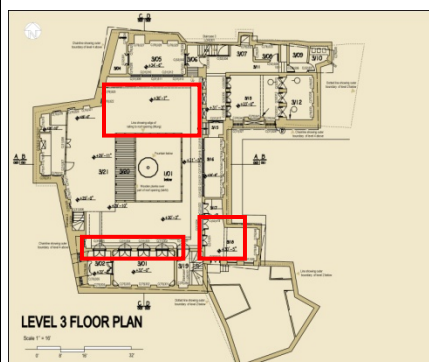
2/04: Preparing Wooden Gola for Terseem Bandi In the Missing Portions.
2/05: Preparing and Fixing of wood pieces in the missing portion of Terseem Bandi.
3/21: Protect the Area from Heavy Rain.
3/18: Lime Plaster
S.Q: Steel Wire Loop.

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Preparing Wooden Gola for Terseem Bandi of Missing Portions.
2/05: Preparation and fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/18: Lime Plaster repair started in the room.
S.Q: Steel Wire loop tied according to the instruction of Mr. Amin Tari, but he doesn't look satisfied so looking more.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 14th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof, Terseem Bandi

Area Mohallah Sethian	Building No. Sehti House I	Room No. 204, 2/05, 3/18, 3/05 SQ
-----------------------------	-------------------------------	--

Title of Works:

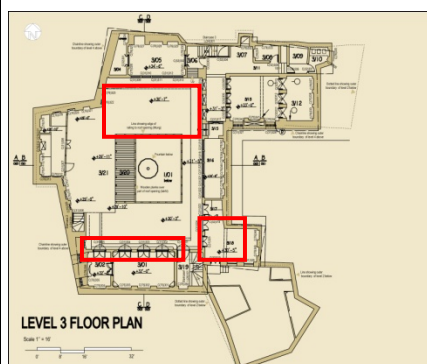
2/04: Preparing Wooden Gola for Terseem Bandi In the Missing Portions.
2/05: Preparing and Fixing of wood pieces in the missing portion of Terseem Bandi.
3/18: Lime Plaster
3/05: Removing of roof Layers.
4/01: Re-install of upper beam of the railing.
S.Q: Steel Wire Loop.

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Preparing Wooden Gola for Terseem Bandi of Missing Portions.
2/05: Preparation and fixing of wood pieces to complete the Terseem Bandi in missing portion.
3/01: Scrapping of doors to remove paint layers and to expose the original layer of wood.
3/05: Removing of flooring layers 2"x4"x8" brick, 1.5" Lime Mortar, 3"Mud.
S.Q: Steel Wire loop tied according to the instruction of Mr. Amin Tari, but he doesn't look satisfied so looking more.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 15th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT

Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar

2. CONSTRUCTION RECORD

Name of Structure:
Terseem Bandi, Flooring

Area	Building No.	Room No.
Mohallah Sethian	Sehti House I	3/01, 02 3/04, 05,

Title of Works:

3/01: Scrapping of doors and cupboards.

3/05: Removing of roof Layers.

3/04: Removing of roof Layer.

Ref. Drg:

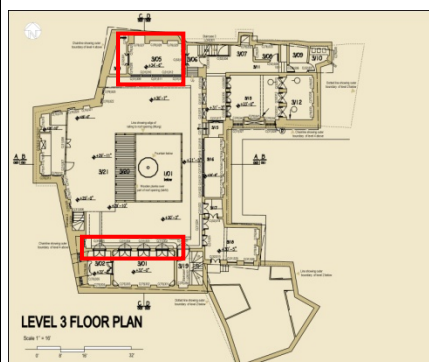
L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Eid-e- Milad
2/05: Eid-e- Milad
3/01: Scrapping of doors and cupboards to remove paint layers and to expose the original layer of wood.

3/05, 04: Removing of flooring layers 2"x4"x8" brick, 1.5" Lime Mortar, 3"Mud.

2.2 Drawings



2.3 Photograph



2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets

Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 16th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring

Area	Building No.	Room No.
Mohallah Sethian	Sehti House I	3/01, 02 3/04, 05, 4/01, SQ

Title of Works:

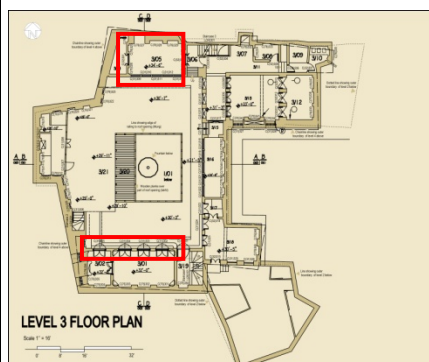
3/01: Scrapping of doors and cupboards.
3/05: Removing of roof Layers.
3/04: Removing of roof Layer.
4/01: Roof Cornice.

Ref. Drg:

L (22)004
L (22)005
L (22)006
2.1 Report (Scope of Work & Survey of Treatment)
2/04: Eid-e- Milad
2/05: Eid-e- Milad
3/01: Scrapping of doors and cupboards to remove paint layers and to expose the original layer of wood.

3/05, 04: Removing of flooring layers 2"x4"x8" brick, 1.5" Lime Mortar, 3"Mud.

4/01: Started erecting scaffolding for the restoration of cornice.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 17th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring

Area	Building No.	Room No.
Mohallah Sethian	Sehti House I	3/01, 02 3/04, 05, 4/01,

Title of Works:
3/01, 02: Scrapping of doors and cupboards.
3/05: Removing of roof Layers.
3/04: Removing of roof Layer.
4/01: Roof Cornice.

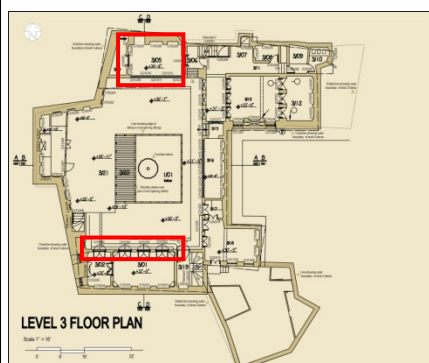
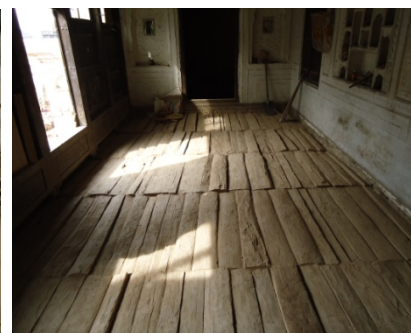
Ref. Drg:
L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)
2/04: Eid-e- Milad
2/05: Eid-e- Milad
3/01: Scrapping of doors and cupboards to remove paint layers and to expose the original layer of wood.

3/05: Cleaning spaces in between and applied anti-termite 2 coats.

3/04: Removed flooring layers 2"x4"x8" brick, 1.5" Lime Mortar, 3"Mud and found 4th, 6th, 7th rafters were dilapidated and Required to be replaced.

4/01: Started erecting scaffolding for the restoration of cornice and terseem bandi of sun shade.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets

Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 18th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring

Area	Building No.	Room No.
Mohallah Sethian	Sehti House I	3/01, 02 3/04, 05, 4/01, SQ

Title of Works:

3/01: Scrapping of doors and cupboards.
3/05: Removing of roof Layers.
3/04: Removing of roof Layer.
4/01: Roof Cornice.

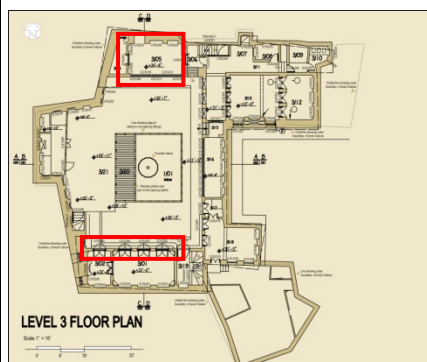
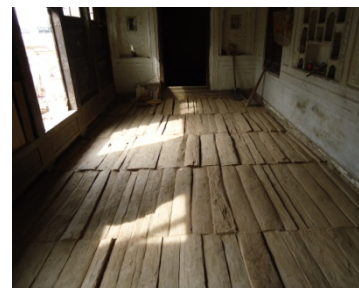
Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)
2/04: Eid-e- Milad
2/05: Eid-e- Milad
3/01: Scrapping of doors and cupboards to remove paint layers and to expose the original layer of wood.

3/05, 04: Removing of flooring layers 2"x4"x8" brick, 1.5" Lime Mortar, 3"Mud.

4/01: Started erecting scaffolding for the restoration of cornice.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 19th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar

2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring

Area	Building No.	Room No.
Mohallah Sethian	Sehti House I	3/01, 02 3/04, 05, 4/01, SQ

Title of Works:

3/01: Scrapping of doors and cupboards.
3/05: Removing of roof Layers.
3/04: Removing of roof Layer.
4/01: Roof Cornice.

Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

2/04: Eid-e- Milad

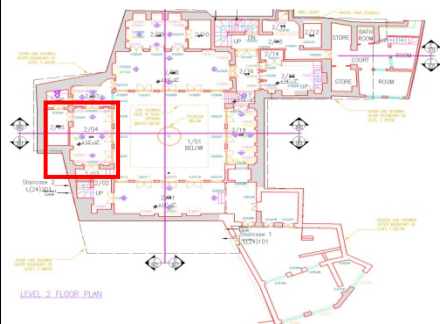
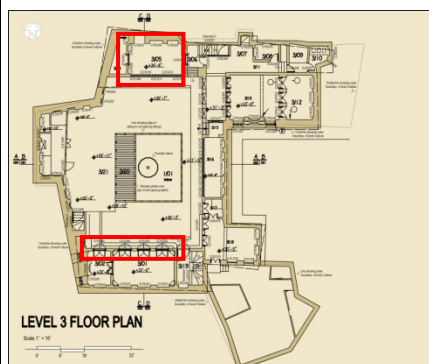
2/05: Eid-e- Milad

3/01: Scrapping of doors and cupboards to remove paint layers and to expose the original layer of wood.

3/05, 04: Removing of flooring layers 2"x4"x8" brick, 1.5" Lime Mortar, 3"Mud.

4/01: Started erecting scaffolding for the restoration of cornice.

2.2 Drawings



2.3 Photograph



2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets
Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 20th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring

Area
Mohallah
Sethian

Building No.
Sehti House I

Room No.
,3/01, 02
3/05,3/04
2/04, 05
4/01, 4/02,
-1/05

Title of Works:

-1/05: Removing the flooring Layers.

2/04: Terseem Bandi.

3/04, 05: Flooring Layers.

3/01, 02: Removing of Paint Layers.

4/01: Cornice re-construction and Repair of Sun Shade.

Ref. Drg:
L (22)004
L (22)005
L (22)006
2.1 Report (Scope of Work & Survey of Treatment)

-1/05: Removing the flooring Layers 2" bricks, 2" White Lime and Mud 12".

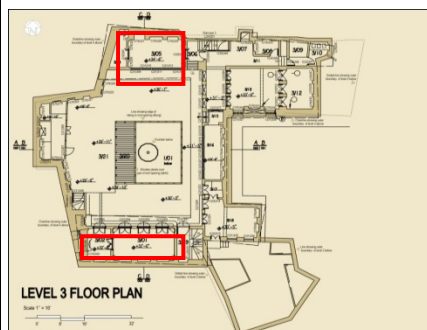
2/04: Preparation of wooden gola joints and erected scaffolding for terseem bandi in the missing portion.

3/01, 02: Removing of paint layers from doors and cupboard to expose the original grains/layer of wood.

3/05: Curing Lime mortar, flooring.

3/04: Treating the cracks appeared in the newly Mortar flooring layer.

4/01: Erecting the scaffolding for re-construction of cornice and repair sun shade.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets, Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 21st Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar

2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring

Area Mohallah Sethian	Building No. Sehti House I	Room No. ,3/01, 02 3/05,3/04 2/04, 05 4/01, 4/02, -1/05
-----------------------------	-------------------------------	--

Title of Works:

-1/05: Removing the flooring Layers.
2/04: Terseem Bandi.
3/04, 05: Flooring Layers.
3/01, 02: Removing of Paint Layers.
4/01: Cornice re-construction and Repair of Sun Shade.

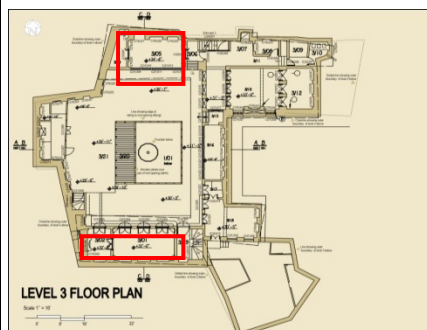
Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

-1/05: Removing the flooring Layers 2" bricks, 2" White Lime and Mud 12".
2/04: Preparation of wooden gola joints and erected scaffolding for terseem bandi in the missing portion.
3/01, 02: Removing of paint layers from doors and cupboard to expose the original grains/layer of wood.
3/05: Curing Lime mortar, flooring.
3/04: Treating the cracks appeared in the newly Mortar flooring layer.
4/01: Erecting the scaffolding for re-construction of cornice and repair sun shade.

2.2 Drawings



2.3 Photograph



2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets, Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 21st Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar

2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring

Area
Mohallah
Sethian

Building No.
Sehti House
I

Room No.
-1/04, 2/04,
3/01,02,SQ
3/21, 4/01

Title of Works:

-1/04: Removing the flooring Layers.
2/04: Terseem Bandi.
3/21: Mung Wood Screen Repair and Flooring preparation.
3/01, 02, 19: Removing of Paint Layers.
4/01: Cornice re-construction and Repair of Sun Shade.
S.Q: Steel Wire Loop

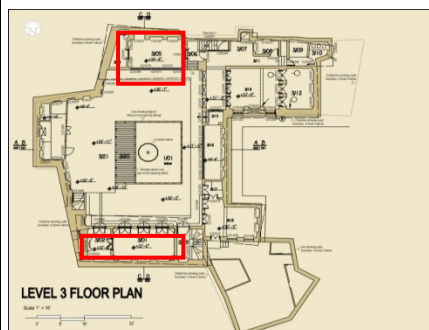
Ref. Drg:

L (22)004
L (22)005
L (22)006

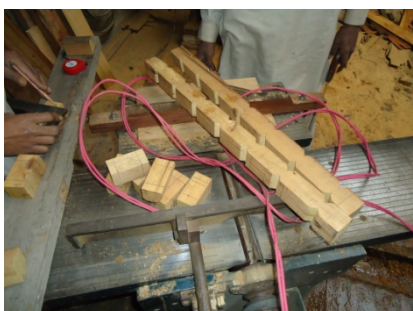
2.1 Report (Scope of Work & Survey of Treatment)

-1/04: Removing the flooring Layers 2" bricks, 2" White Lime and Mud 12".
2/04: Preparation of wooden gola joints and erected scaffolding for terseem bandi in the missing portion.
3/01, 02: Removing of paint layers from doors and cupboard to expose the original grains/layer of wood
3/21: Mung, Wood Screen Repair Started and Flooring preparation continues.
4/01: Re-construction of cornice and repair sun shade continues.
S.Q: Enclosed the red zone with Steel Wire Loop to avoid any mishap.

2.2 Drawings



2.3 Photograph



2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets, Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 24th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar

2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring

Area
Mohallah
Sethian

Building No.
Sehti House
I

Room No.
-1/05, 2/04,
3/01,02,SQ
3/21, 4/01

Title of Works:

-1/04: Removing the flooring Layers.
2/04: Terseem Bandi.
3/21: Mung Wood Screen Repair and Flooring preparation.
3/01, 02, 19: Removing of Paint Layers.
4/01: Cornice re-construction and Repair of Sun Shade.
S.Q: Steel Wire Loop

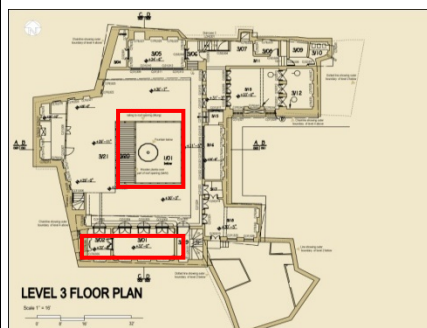
Ref. Drg:

L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

-1/04: Removing the flooring Layers 2" bricks, 2" White Lime and Mud 12".
2/04: Fixing of new wood pieces in the border to complete the missing portion terseem bandi.
3/01, 02: Removing of paint layers from doors, cupboard and ventilators to expose the original grains/layer of wood
3/21: Mung, Wood Screen Repair Started and Flooring preparation continues.
4/01: Re-construction of cornice and repair of sun shade continues.
S.Q: Decided to Enclosed the red zone with Steel Wire Loop by the Structural Engineer to avoid any mishap.

2.2 Drawings



2.3 Photograph



2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets, Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 25th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar

2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring

Area
Mohallah
Sethian

Building No.
Sehti House
I

Room No.
-1/05, 3/01,
02, 3/03
3/21, 2/04,
4/01

Title of Works:

-1/05: Removing the flooring Layers.
2/04: Terseem Bandi.
3/03: Lime plaster Repairing.
3/21: Mung Wood Screen Repair and Flooring preparation.
3/01, 02, 19: Removing of Paint Layers.
4/01: Cornice re-construction and Repair of Sun Shade.
S.Q: Steel Wire Loop

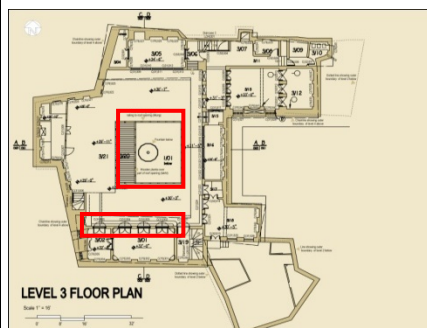
Ref. Drg:

L (22)002
L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

-1/05: Removing the flooring Layers 2" bricks, 2" White Lime and Mud 12".
2/04: Fixing of new wood pieces in the border to complete the missing portion terseem bandi.
3/03: Lime plaster repairing on the walls up to dado level.
3/01, 02, 19: Removing of paint layers from doors, cupboard and ventilators to expose the original grains/layer of wood
3/21: Mung, Wood Screen Repair, and Flooring preparation continues.
4/01: Re-construction of cornice and repair of sun shade continues.
S.Q: Enclosed the red zone with Steel Wire Loop by the Structural Engineer to avoid any mishap.

2.2 Drawings



2.3 Photograph



2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets, Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 26th Feb, 2011

Name
Hafiz Arif

Designation

Signature

CONSERVATION RECORD DOCUMENT
Preventive Conservation / Conservation Works

SETHI HOUSE, Peshawar
2. CONSTRUCTION RECORD

Name of Structure:
Roof Cornice, Terseem Bandi,
Flooring, Lime Plaster

Area
Mohallah
Sethian

Building No.
Sehti House
I

Room No.
-1/06, 2/04,
3/01,02,19,
3/03, SQ
3/21, 4/01

Title of Works:

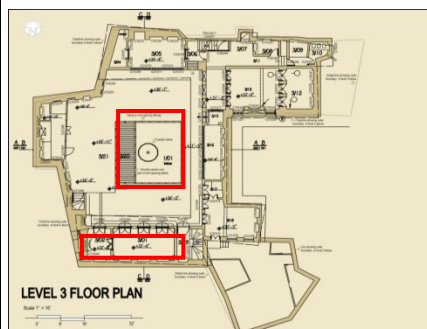
-1/06: Removing the flooring Layers 2" bricks, 2" White Lime and Mud 12".
2/04: Fixing of Border Wood Pieces.
3/01, 02, 19: Removing of Paint Layers.
3/03: Lime Plaster.
3/21: Mung and Wood Screen Repairing.
4/01: Cornice re-construction and Repair of Sun Shade.

Ref. Drg:

L (22)002
L (22)004
L (22)005
L (22)006

2.1 Report (Scope of Work & Survey of Treatment)

-1/06: Removing the flooring Layers 2" bricks, 2" White Lime and Mud 12".
2/04: Fixing of new wood pieces in the border to complete the missing portion of terseem bandi.
3/01, 02, 19: Removing of paint layers from doors, cupboard and ventilators to expose the original grains/layer of wood
3/21: Mung, Wood Screen Repair Started and Flooring preparation continues.
4/01: Re-construction of cornice and repair of sun shade continues.
S.Q: Enclosed the red zone with Steel Wire Loop by the Structural Engineer to avoid any mishap.

2.2 Drawings

2.3 Photograph

2.4 Specification of Materials

Deodar Wood. Sand paper, Paint Remover Eagle or hashmi Brand, sharp glass edge. Brushes, Scrappers
Polythene Sheets, Lime Coarse Aggregate Mix 1:2:4 (White Lime: Fine Lime: Coarse Aggregate) Bricks reused.

2.5 Form prepared by

Date: 27th Feb, 2011

Name
Hafiz Arif

Designation

Signature